

PJ/PV/PH-SERIES Profile Projector



OPTICAL MEASURING

Projector PJ/PV/PH Series

Each Mitutoyo profile projector is a measuring machine that performs measurement, inspection, and observation efficiently by projecting an image of a test workpiece on the stage onto a viewing screen under accurate magnification.

The inherently non-contact measurement method of profile projectors makes this type of instrument highly suitable for measuring small parts that are unmeasurable with general-purpose contact instruments or easily deformed plastic parts, and can also be used to observe the surface profiles of workpieces or inspect minute assemblies with surface illumination. Additionally, a wide selection of accessories allows advanced measurement and inspection of various workpieces.

These machines can be installed and used in a wide range of environments from inspection rooms to manufacturing and processing sites.

Provides reliable measurements in manufacturing site environments.





PJ Series

Screen diameter 300 mm Available in 2 types: PJ-PLUS (white LED

light source) and PJ-H30 (high accuracy) Broad lineup of stages for handling from minute parts to large workpieces

Controls centered at the front for better operability

Screen diameter 500 mm Equipped with a large forward-tilted screen Perfect for comparative measurements with enlarged drawings and tracing of projected

Recommended for precision and minute parts such as watch and electronic components

PV Series

images

PJ-PLUS

.....P4 - 7

PJ-H30P8 - 11

PV-5110P12 - 13

- **1**2.20

Calle Le 120

AN PINELA





-

2

10

PH-3515F



PH Series

Screen diameter 350 mm

Standard model in the edged tool industry. Perfect for observation and measurement of cutting tools (end mills, cutters, and tipped saws)

Equipped with a high-rigidity stage boasting a maximum load of 45 kg

Horizontal beam design makes loading/unloading the stage very easy Stage

.....P16 - 17

AccessoriesP18 - 22

Basic optical terminologyP23



The profile projector that "can be operated intuitively" even by inexperienced people and also has excellent durability and energy-saving performance thanks to the adoption of an "LED illumination source" and "fanless cooling system". It provides stable dimension and angle measurements in harsher environments, such as manufacturing and processing lines, than can be handled by conventional models.



Features (high durability and energy saving)

Thanks to the LED light source, lamp burnout is no longer a worry!




Compared with a halogen bulb

- Long service life
- Low power consumption (main unit): Approx. 85 % lower (400 W → 60 W)

Main unit contamination by oil mist or dust is highly unlikely due to the fanless system.



Improved durability

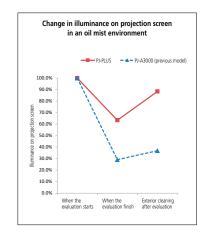

Adoption of the LED illumination source has obviated the need for installing a cooling fan into the main unit of the measuring instrument and has drastically decreased the entry of oil mist, dust, etc. via the cooling fan into the instrument body.

This also drastically reduces the adhesion of oil and dust to the internal mirror, lens, and light source. The graph on the left shows changes in illuminance on the projection screen in case of long-term installation together with a conventional model (the projector with a fan) in a misty processing site. As compared with the conventional model, the LED light source type improves the rate of decline in illuminance by about 50 %. It maintains high optical performance by preventing the entry of mist into the main unit even in the harsh environment of a processing line.

The unit has excellent durability and requires less frequent maintenance, resulting in lower maintenance costs.

Note 1: Exterior cleaning of the projection lens surface, stage glass top, etc. is easy.

Note 2: The graph data shows measurement examples, and measured values may vary according to the installation environment and so on.

Observation light source

Stepless illumination adjustment




The conventional 2-step illumination adjustment has been changed to stepless control so the level of illumination can be precisely set to suit the surface texture and color of the workpiece.



LED (White)

No color change in projected image with changes in illumination intensity.

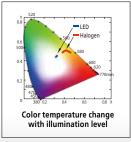

Color temperature varies significantly with the level of halogen illumination but not so much with LED illumination, so the appearance of the image varies a lot less as the LED level is adjusted. Also, the projected image under LED illumination is sharper and easier on the operator's eyes, which contributes to a reduction in fatigue and therefore more efficient inspection and measurement.

LED Circular Illuminator for PJ-PLUS Optional



Example of attaching the LED circular illuminator on PJ-PLUS



LED illumination light can emphasize the contrast of projected workpiece images, stereoscopic and sharp observation.

The projected image can thus be observed at high color reproducibility while retaining a low power consumption: 17.4 W with a long operating life of 30,000 hours.

Specifications

Order No.	172-502*
Compatible model	PJ-PLUS (Projection lens 10X and 20X)
Illumination source	White LED
Power consumption	12 V / 17.4 W
LED life (reference)	30,000 H

*The optional accessory (12AAX044) is necessary to attach this product to the PJ-PLUS 20X projection lens.

PJ-PLUS

PJ-PLUS

Features (Operability)

High visibility digital display



Since the digital counter (X.Y axes and angle) built into all models as standard uses a high-intensity LED and a large character display, it secures high visibility unaffected by the environment. In addition to zero-setting and direction change, the data output of each counter value adopts the highly versatile RS-232C.

Resolution: 0,001 mm or 0,0001 in/0,001 mm

Main unit side panel (output connectors)




Technical Data

Projected image		Inverted
Effective diameter		ø315 mm
	Screen rotation	±360° (The counter displays up to ±370°)
Protractor screen	Angle reading	Digital counter (ABS/INC mode switching), Zero Set
	Resolution	1' or 0,01° (switchable)
	Cross-hairs	90° solid lines
		10X (Standard accessory), 20X, 50X, 100X
Projection lens	Magnification	External half-reflecting mirror for surface illumination (only for 10X, 20X)
	Lens mount	Bayonet mount
Magnification	Contour illumination	±0,1 % or less of nominal maginification
accuracy*	Surface illumination	±0,15 % or less of nominal maginification
Maximum workpie	ece height	Refer to the projection lenses L1 right
Contour illumination		White LED light source, Telecentric, Variable brightness adjustment
Surface illumination		White LED light source, With an adjustable condenser lens, Variable brightness adjustment
Resolution for X/Y counter		0,001 mm or 0,0001 in/0,001 mm
Power supply		100 V to 240 V AC, 50/60 Hz
Mass		114 kg (PJ-P1010A), 118 kg (PJ-P2010A)
Power consumption		60 W

* Our magnification accuracy standard only checks contour illumination (that it is ±0,1 % or less). (If the magnification accuracy under contour illumination is a permissible value, that under surface illumination is also guaranteed to be within ±0,15 % of our standard.) Note: For the stage specification, refer to page 16.

Dimensions

(Unit: mm)

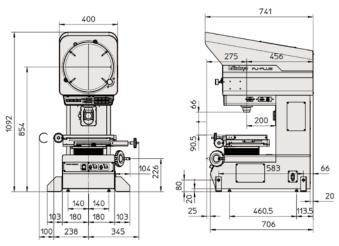

PJ-P2010A

Projection lenses (10X is a standard accessory)








(Unit: mm)

								(0)	
		C	Contour illumination			5	urface ill	uminatio	n
Magnificati	on	10X	10X 20X 50X 100X			10X	20X	50X	100X
View field	ł	31,5	15,7	6,3	3,1	31,5	15,7	6,3	3,1
Working distance	L2	66	32.5	12.6	5	20	2	12.6	5
PJ-P1010A	L1		91						
FJ-FIUIUA	D	182	87	27	10	182	61	27	10
	L1	90.5							
PJ-P2010A	D	181	87	27	10	181	61	27	10

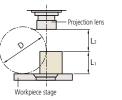

L1: Max. height where focusing is available L2: Max. step where focusing is available

- (working distance)
- D: Max. diameter when a cylinder generatrix is projected on the centerline of the screen

Oblique reflection mirror


This is used for observing low-reflectivity workpieces, such as plastic parts, and the surfaces of parts with high surface roughness.

	E
172-229 (for 10X)	172-230 (for 20X)

Order No.	172-229 172-230		
Applicable models	PJ-PLUS		
Mass	0,3 kg	0,07 kg	




6

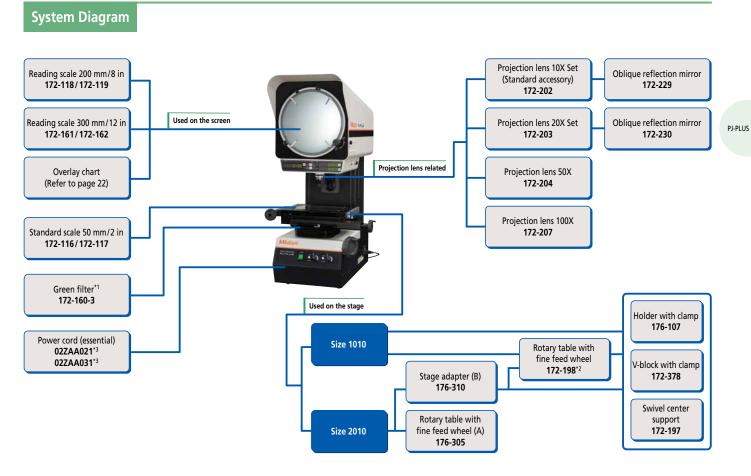

*1 This is inserted beside the stage adapter during use.

*2 It is not possible to use 172-198 (rotary table with fine feed wheel) and 172-197 (swivel center support) at the same time. *3 UK: 02ZAA031, CEE: 02ZAA021

Note: If an optional unit is installed on the stage, the L1 (Max. workpiece height) length is reduced by the optional unit height.

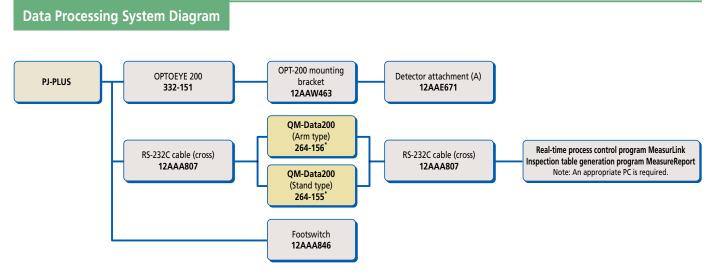

For details, refer to the QM-Data200 and Vision Unit brochure.

* To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, D for CEE, DC for CCC, E for BS, K for KC, C and No suffix are required for PSE.

PJ-PLUS

PJ-H30

PJ-H30

High-end model of the PJ-series that produces bright and sharp projected images. High-rigidity main unit equipped with a linear scale for realizing high-accuracy measurements. Lineup of 8 models, derived from combinations of 4 stage types (100×100 mm to 300×170 mm) and manual focusing/motor-driven focusing models.




Features (Bright, beautiful observation)

Also equipped with oblique reflected illumination with good color reproducibility as standard




The reflected illumination comprises vertical illumination, which goes through the projection lens, and oblique illumination, with changeable angle of illumination emitter, as standard. It is effective in three-dimensional observation with enhanced color reproducibility.

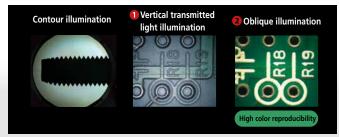

Features (Measuring accuracy)

Pursuit of measurement accuracy

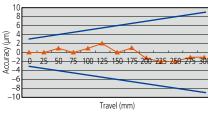

X, Y axes (3,0+0,02L) μm

Reference standard: JIS B 7184 20 °C Measurement accuracy of each axis: (6+0,04L) µm or less L= Measuring length mm


Red graph shows measured X-axis accuracy for a randomly selected projector.

The profile projector has to maintain a high level of performance, not only in terms of optical performance but also comprehensive measurement accuracy. The **PJ-H30** Series, which performs not only contour observation and comparative inspection but also two-dimensional measurement with high accuracy, has achieved the above measurement accuracy in all stage sizes.^{*} Having achieved both long-stroke measurement and high accuracy, it is helpful in every measurement setting.

* Compliant with JIS B 7184, measurement method for each of the X,Y axes

Features (Maintainability)

Easy-to-replace lamp housing design

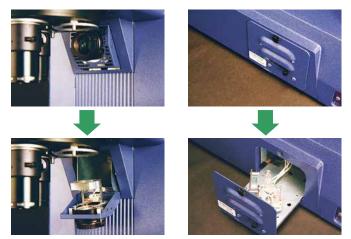

Having a halogen lamp burn out during use can cause a lot of trouble. Immediately after a lamp burns out, it is too hot to be replaced. The **PJ-H30** Series has a slide change mechanism, which allows you to change lamps from outside; therefore, even if the lamp burns out suddenly, you can continue inspection and measurement without worry (for transmitted illumination only). The opening of the housing can be performed by loosening a single screw, and this can be done safely as there is no flow of electricity.

Features (Operability)

All models equipped with turrets as standard



The turret of the **PJ-H30** Series uses low-friction bearings that enable smooth and rapid rotary motion for changing magnification by bringing different projection lenses into the light path. The turret body uses bayonet mounts to aid quick attachment and detachment of lenses.

Focusing with high operability





Manual focusing handle of PJ-H30A

PJ-H30D (motor-driven focusing) front panel

To place a test workpiece on the stage and focus swiftly, an easy-to-grip handle shape and its position are very important. Therefore, the **PJ-H30** Series has an oblique manual focusing handle that lets you operate in a natural position, whether standing or sitting, without awkwardness. Moreover, a high-operability jog shuttle with motor-driven focusing is also available and its smooth movement contributes to less fatigue in observation and measurement.

Note: PJ-H30D (with motor-driven focusing) does not come with a manual focusing handle.

Stepless illumination adjustment



Stepless illumination adjustment has been adopted so as to provide moderate illuminance according to the surface texture and color of the workpiece. Illumination strength ranges from weak to strong and this method is also effective in extending the halogen lamp life, which is enhanced by using a soft start feature to limit inrush current.

Projection Lens 10X with C mount Optional



Example of attaching the Projection Lens 10X with C mount on PJ-H30



The projection lens is equipped with a C mount, therefore a compatible digital camera can be attached. Retrofit is possible Profile Projector (PJ-H). A workpiece can be observed on the large-size projection screen, and simultaneously the color image can be saved on the camera and observed on the monitor.

Specifications

Order No.	172-500
Camera Projected Image	Inverted
Camera Magnification	0.71X ^{*1}
Compatible Sensor Size	Four Thirds 4/3 type ^{*2}
Camera Mount	C mount
Mountable Mass	0.9 kg or less

*1 The magnification accuracy of the camera is not guaranteed.

*2 Vignetting occurs on the four corners of a camera image under the contour illumination. Note 1: Refer to page 10 for operation distance.

Note 2: The magnification to projection Screen is 10X.

LED Circular Illuminator for PJ-H30 Optional



LED illumination can emphasize the contrast of projected workpiece images, providing stereoscopic and sharp observation. The projected image can be observed with high color reproducibility, which is not supported by the existing halogen-type surface illumination. Low power consumption: 17.4 W, and long operating life: 30,000 hours.

Specifications

Order No.	172-501
Compatible model	PJ-H30 10X Projection Lens with C mount, Projection lens 10X and 20X
Illumination source	White LED
Power consumption	12 V / 17.4 W
LED life (reference)	30,000 H

Features (Operability)

High visibility digital display



PJ-H30

Since the digital counter (X,Y axes and angle) built into all models as standard uses a high-intensity LED and a large-character display, it secures high visibility unaffected by the environment. In addition to zero-setting and direction change, the data output of each counter value adopts the highly versatile RS-232C.

Resolution: 0,001 mm or 0,0001 in/0,001 mm*

 $\,*\,$ 0,5 μm or 0,1 μm readings can also be equipped. Please ask our Techno Service.


Technical Data

Projected image		Erect
	Effective diameter	ø306 mm
	Screen rotation	±360° (The counter displays up to ±370°)
Protractor screen	Angle reading	Digital counter (ABS/INC mode switching), Zero Set
	Resolution	1' or 0.01° (switchable)
	Cross-hairs	Solid lines
Projection lens	Magnification	10X (Standard accessory), 5X, 20X , 50X, 100X Parfocal lens Half-reflecting mirror for surface illumination
	Lens mount	Bayonet mount (registered utility model), 3-mount turret
Magnification	Contour illumination	±0.1 % or less of nominal maginification
accuracy*1	Surface illumination	±0.15 % or less of nominal maginification
Maximum workpie	ece height	105 mm* ²
Contour illumination		24 V, 150 W 50 h Halogen bulb (515530) Zoom Telecentric, Heat-absorbing filter Cooling fan, Non-stepped brightness adjustment Soft lighting function (reduced inrush current) Lamp mount switching system
Surface illumination		24 V, 150 W, 50h Halogen bulb (515530) Vertical/oblique illumination with an adjustable condenser lens Heat-absorbing filter, Cooling fan, Non-stepped brightness adjustment, Soft lighting function (reduced inrush current)
Focusing		Projection screen head driving PJ-H30A (manual), PJ-H30D (power drive)
Resolution for X/Y counter		0.001 mm or 0.0001 in/0.001 mm* * You can specify 0.5 μm or 0.1 μm resolution. (Available on request.)
Power supply		ON/OFF switch, 100 to 240 V AC (unneeded switching voltage), GND terminal, 50/60 Hz, Power cord (2 m)
Mass		176 to 212 kg
Power consumption		Approx. 420 W

*1 Our magnification accuracy standard only checks contour illumination (that it is ±0.1 % or less). (If the magnification accuracy under contour illumination is a permissible value, that under surface illumination will also be guaranteed to be within ±0.15 % of our standard.)

*2 For the stage specification, refer to page 16.

Dimensions

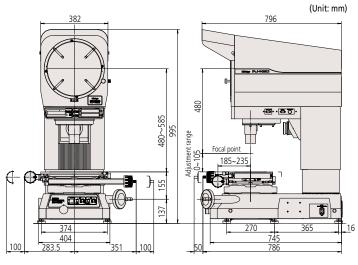

PJ-H30A2010B


Main unit side panel



Projection lenses (10X is a standard accessory)



Order No.	View field (mm)	L1 (mm)	L2 (mm)	D (mm)
5X Lens 172-271	61.2	105	66	148
10X Lens (Standard accessory) 172-472	30.6	105	70.5	197
20X Lens 172-473	15.3	105	56.5	137
50X Lens 172-474	6.12	105	50	114
100X Lens 172-475	3.06	105	50	114

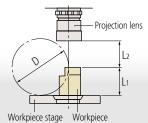


L1: Max. height where focusing is available

- L2: Max. step where focusing is available (working distance)
- D: Max. diameter when a cylinder generatrix is projected on the centerline of the screen

Note: When rotary table is not mounted.

10


PJ-H30

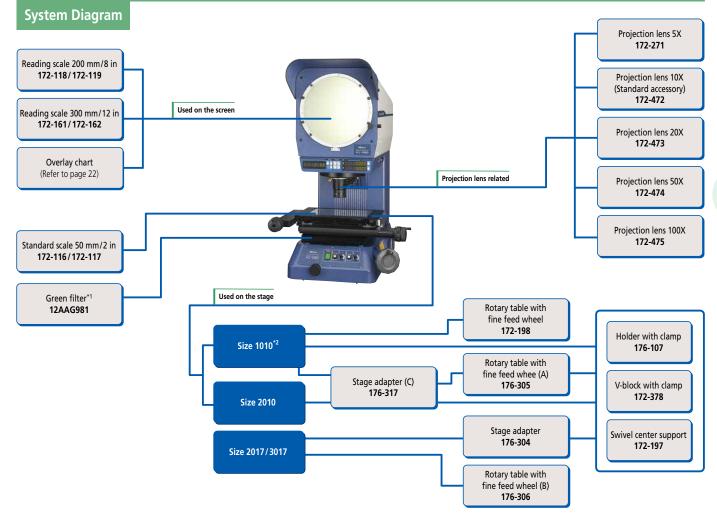

*1 This is inserted beside the stage adapter during use.

*2 For the 1010 size, it is also possible to directly attach the "holder with clamp (176-107)," "V-block with clamp (172-378)," and "swivel center support (172-197)", bypassing the "stage adapter C (176-317)."

Note: If an optional unit is installed on the stage, the H (Max. workpiece height) length is reduced by the optional unit height.

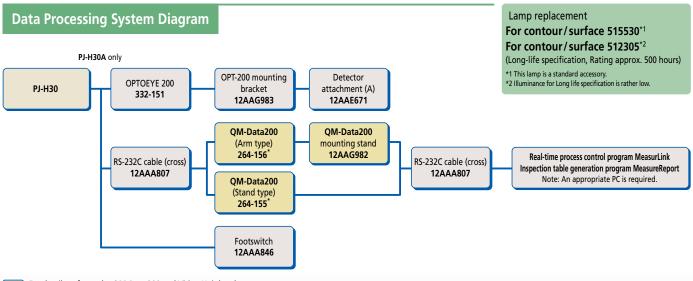

For details, refer to the QM-Data200 and Vision Unit brochure.

* To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, D for CEE, DC for CCC, E for BS, K for KC, C and No suffix are required for PSE.




Technical Data

PV-5110

Projected image		Inverted	
Trojected intage	Effective diameter	ø508 mm	
	Screen material	Fine-ground glass	
	Screen rotation	±360° (The counter displays up to ±370°)	
Protractor screen	Angle reading	Digital counter (ABS/INC mode switching), Zero Set	
	Resolution	1' or 0.01° (switchable)	
	Cross-hairs	90° solid lines	
	0 Line (Index)	Built-in, With a LED backlight	
Ducientian lana	Magnification	5X, 10X (Standard accessory), 20X, 50X, 100X	
Projection lens	Lens mount	Insert type mount	
Magnification	Contour illumination	±0.1 % or less of nominal maginification	
accuracy*	Surface illumination	±0.15 % or less of nominal maginification	
Maximum workpie	ece height	Refer to the projection lenses (H) right.	
		24 V, 150 W, 500 h Halogen bulb (512305)	
		Mount switching system	
Contour illuminati	on	Telecentric, Heat-absorbing filter	
		Cooling fan, 2-step (High/Low) brightness switch	
		Can be used in conjunction with color filter	
	-	24 V, 150 W, 500 h Halogen bulb (512305)	
		Heat-absorbing filter, Adjustable condenser lens	
Surface illumination	on	Oblique illumination (for 5X, 10X and 20X)	
		Cooling fan, 2-step (High/Low) brightness switch	
Focusing		Stage part drive	
		Manual	
Power supply		100 V, 110 V, 120 V, 220 V, 230 V, 240 V AC	
		external switching	
Mass		Approx. 210 kg (including X-Y stage)	
Power consumption		Approx. 560 W	


PV-5110

* Our magnification accuracy standard only checks contour illumination (that it is ±0.1 % or less). (If the magnification accuracy under contour illumination is a permissible value, that under surface illumination will also be guaranteed to be within ±0.15 % of our standard.) Note: For the stage specification, refer to page 17.

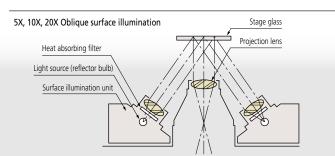

Equipped with a 500 mm forward-tilted screen, that is perfect for comparative measurements with enlarged drawings and tracing of projected images. This model supports improvement in efficiency of the inspection of mass-production precision parts.

Dimensions

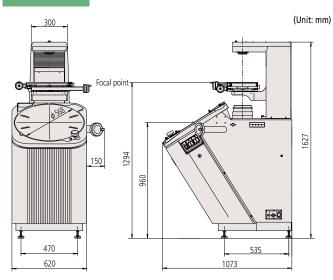

Note: To mount the counter (KA-212) and counter stand, approximately 300 mm space is required on the right-hand side of the main unit.

Projection lenses (10X is a standard accessory)




Order No.	View field (mm)	L1 (mm)	L2 (mm)	D (mm)
5X Lens Set 172-401	101.6	125	60 (27)	120
10X Lens Set (Standard accessory) 172-402	50.8	181	60	120
20X Lens Set 172-403	25.4	206	60	120
50X Lens Set 172-404	10.16	87	32.4	64.8
100X Lens Set 172-405	5.08	87	22.5	45

Note 1: (): When using surface illumination

Note 2: Each lens set contains the condenser lenses for illumination.

Note 3: D is for the case of contour illumination.

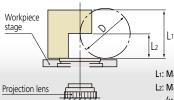


L1: Max. height where focusing is available

L2: Max. step where focusing is available (working distance)

D: Max. diameter when a cylinder generatrix is projected on the centerline of the screen

System Diagram

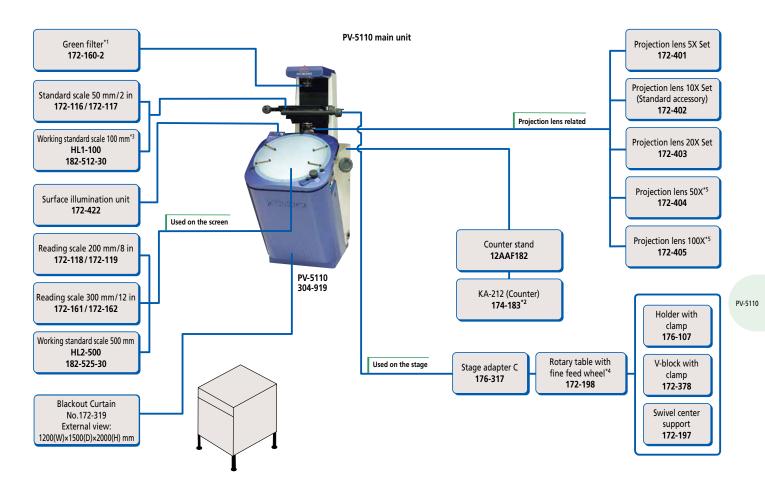


*1 This is inserted in the contour light source section during use.

*2 To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, D for CEE, DC for CCC, E for BS, K for KC, C and No suffix are required for PSE.

*3 Used on the stage. It is projected onto the screen to check the magnification accuracy with a reading scale.

*4 Since the rotary stage section is small, if it is used for a large stage, some restrictions may be imposed on the measuring range.

*5 When using a 50X or a 100X projection lens, you need to remove the stage glass in order to prevent a collision between the stage glass for the X/Y stage and the projection lens. Note: If an optional unit is installed on the stage, the H (Max. workpiece height) length is reduced by the optional unit height.

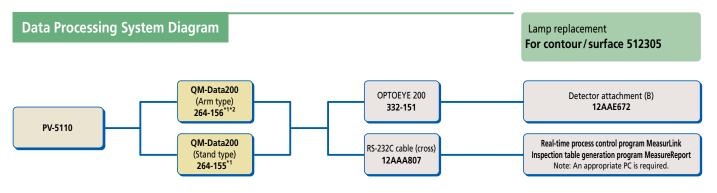

For details, refer to the QM-Data200 and Vision Unit brochure.

*1 To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, D for CEE, 00 for CCC, E for BS, K for KC, C and No suffix are required for PSE. *2 The arm type cannot be used concurrently with a counter stand.

PV-5110

PH-3515F

A standard in the edged tool industry, it is perfect for contour observation and measurement of edged tools (such as end mills, cutters, and tipped saws), screws, springs, and the like. Equipped with a high-rigidity stage with a long stroke of 254×152 mm and a load-carrying capacity of 45 kg, supporting even long, heavy workpieces.





Technical Data

Projected image		Erect ^{*1} (PH-3515F), Inverted (PH-A14)	
	Effective diameter	ø353 (13.9 in) mm (PH-3515F), ø356 (14 in) mm (PH-A14)	
	Screen material	Fine-ground glass	
Protractor screen	Screen rotation	±360° (The counter displays up to ±370°)	
	Angle reading	Digital counter (ABS/INC mode switching), Zero Set	
	Resolution	1' or 0.01° (switchable)	
	Cross-hairs	90° solid lines	
Projection lens	Magnification	10X (Standard accessory) 5X (PH-3515 only), 20X, 50X, 100X	
-	Lens mount	Screw mount	
Magnification	Contour illumination	±0.1 % or less of nominal maginification	
accuracy*2	Surface illumination	±0.15 % or less of nominal maginification	
Maximum workpie	ece height	Refer to the projection lenses L1 right.	
		24 V, 150 W, 500 h Halogen bulb (515530) Telecentric, Heat-absorbing filter	
Contour illuminati	on	Cooling fan, 2-step (High/Low) brightness switch: PH-3515F,	
		(Lit together with main power activation: PH-A14)	
		Can be used in conjunction with color filter	
		24 V, 200 W, 500 h Parabolic halogen bulb	
с с н : н		(12BAA637): PH-3515F, (24V 150W, common to	
Surface illumination	on	the contour illumination: PH-A14) Adjustable condenser lens, Heat-absorbing filter	
		Cooling fan	
		Stage part drive	
Focusing		Manual	
Power supply		100 V, 110 V, 120 V, 220 V, 240 V	
		AC external switching (PH-3515F)	
		100 V, 120 V, 130 V, 220 V, 230 V, 240 V	
		AC external switching (PH-A14)	
		50/60 Hz Power cord (2 m)	
Mass		150 kg (PH-3515F), 140 kg (PH-14)	
Power consumptio	n	Approx. 410 W (PH-3515F), 200 W (PH-A14)	


*1 The projected image of the workpiece is erect but inverted horizontally, which means that the vertical orientation and displacement direction of the image is the same as on the workpiece side, but the horizontal orientation and displacement direction are reversed.

*2 Our magnification accuracy standard only checks contour illumination (that it is ±0.1 % or less). (If the magnification accuracy under contour illumination is a permissible value, that under surface illumination will also be guaranteed to be within ± 0.15 % of our standard.)

Note 1: X and Y counters are not built into the projector main unit. If a counter display is required, it is recommended that a QM-Data200 or KA-212 is purchased separately.

Note 2: The indicated value of a measurement may be slightly smaller than the actual value due to optical distortion caused by the illumination conditions.

Note 3: For the stage specification, refer to page 17.

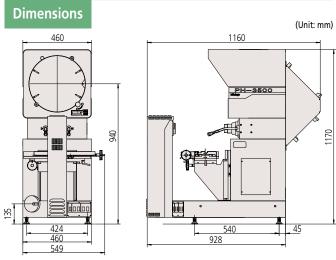

Note 1: To mount the optional counter (KA-212) and counter stand, approximately 300 mm space is required on the right-hand side of the main unit. Note 2: Refer to page 17 for the dimensions of PH-A14.

Projection lenses (10X is a standard accessory)

PH-3515F

Order No.	View field (mm)	L1 (mm)	L2 ^{*2} (mm)	D (mm)	H (mm)
5X Lens Set 172-145	70.6	175	160 (64)	152.4	152.4
10X Lens Set (Standard accessory)*1 172-184	35.3	235	93 (35)	152.4	152.4
20X Lens Set 172-173	17.65	235	40 (40)	116	152.4
50X Lens Set 172-165	7.06	80	14.6 (14.6)	30.4	152.4
100X Lens Set 172-166	3.5	109	9.5 (9.5)	19	152.4


*1 The 10X lens set includes one for half-reflecting mirror F5X (172-294) and one for 10X (172-295). *2 Dimension L2 values in parentheses are those under surface illumination.

PH-A14

Order No.	View field (mm)	L1 (mm)	L2* (mm)	D (mm)	H (mm)
10X Lens Set (Standard accessory) 172-011	35.6	235	93	130	102
20X Lens Set 172-012	17.8	235	40	116	102
50X Lens Set 172-013	7.12	109	14.6	31.3	102
100X Lens Set 172-014	3.56	109	9.5	19.2	102

 \ast Dimension L2 values in parentheses are those under surface illumination.

Projection lens

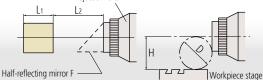


L1: Max. height where focusing is available

L2: Max. step where focusing is available (working distance)

D: Max. diameter when a cylinder generatrix is projected on the centerline of the screen

H: Max. size from optical axis and workpiece stage surface

PH-3515F

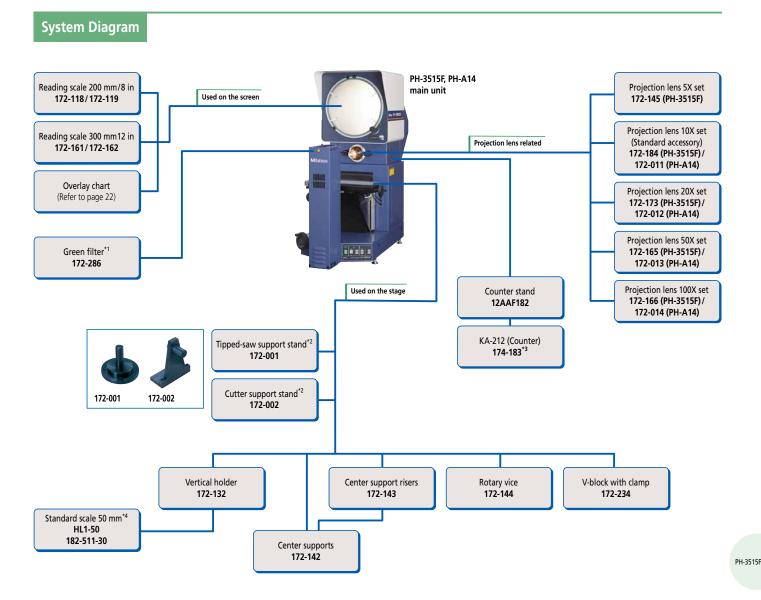


*1 This is inserted in the contour light source section during use.

*2 The tipped-saw and cutter support stands support a center hole diameter of 25.4 mm.

*3 To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, D for CEE, DC for CCC, E for BS, K for KC, C and No suffix are required for PSE.

*4 Reference scale for checking the magnification accuracy. It is fixed on the stage with a vertical holder and projected on the screen to check the magnification with HL2.

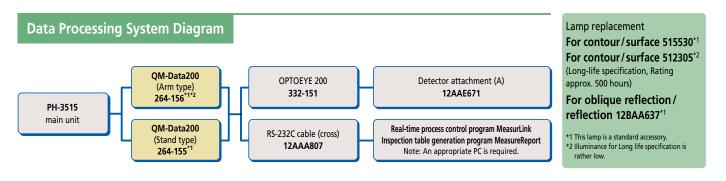

For details, refer to the QM-Data200 and Vision Unit brochure.

*1 To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, D for CEE, DC for CCC, E for BS, K for KC, C and No suffix are required for PSE. *2 The arm type cannot be used concurrently with a counter stand.

PH-3515F

Stage

PJ-PLUS				
XY range		100×100 mm	200×100 mm	
PJ-PLUS main unit	Model	PJ-P1010A	PJ-P2010A	
	Order No.	302-801-10	302-802-10	
Unit system for the counter unit		mm/in	mm/in	
Measuring unit		Digital scale		
Quick-release mechanism		X and Y axes		
Top surface size		250×250 mm	350×280 mm	
Effective size of stage glass		142×142 mm	240×140 mm	
Stage glass thickness		5 mm	8 mm	
Stage glass		12BAE041	12BAD760	
Swivel adjustment range		-	_	
Maximum loading		10 kg	8 kg	

Note: Local power coord. CEE: 02ZAA021, UK: 02ZAA031

PJ-H3	0					
XY range		100×100 mm	200×100 mm	200×170 mm	300×170 mm	
Protractor screen	Model	PJ-H30A1010B	PJ-H30A2010B	PJ-H30A2017B	PJ-H30A3017B	
Protractor screen	Order No.	303-712-1*	303-713-1 [*]	303-714-1*	303-715-1*	
Protractor screen/	Model	PJ-H30D1010B	PJ-H30D2010	PJ-H30D2017B	PJ-H30D3017B	
OPTOEYE built-in/ motor-driven focusing	Order No.	303-732-1 [*]	303-733-1 [*]	303-734-1*	303-735-1*	
Measuring unit			High-accurac	y digital scale	y digital scale	
Quick-release mechanism			X and Y ax	es standard		
Top surface size		300×240 mm	350×280 mm	410×342 mm	510×342 mm	
Effective size of stage glass		180×150 mm	250×150 mm	270×240 mm	370×240 mm	
Stage glass thickness		6 mm	6 mm	8 mm	8 mm	
Stage glass		380412	382762	12BAD363	12BAD330	
Swivel adjustment range	iustment range ±3 ° (right)		±5° (left)			
Maximum loading		10 kg		20 kg		
Measuring accuracy		(3+0.02L) µm L: Measured length (mm) Note: The measurement method conforms to JIS B 7184.			o JIS B 7184 .	

* To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, -1D for CEE, -1 DC for CCC, -1E for BS, -1K for KC, C and No suffix are required for PSE.

Stage

PV-5110	
XY range	200×100 mm (164×68 mm)*1
PV-5110 main unit Order No.	302-919 ^{*2}
Measuring unit	Digital scale
Quick-release mechanism	X and Y axes
Top surface size	380×250 mm
Effective size of stage glass	266×170 mm
Stage glass thickness	6 mm
Stage glass	382762
Swivel adjustment range	±3°
Maximum loading	5 kg

*1 () The range where no shading is observed using a 5X projection lens.

*2 To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, -1D for CEE, -1 DC for CCC, -1E for BS, -1K for KC, C and No suffix are required for PSE.

PH-3515F PH-A14 (Picture right is PH-3515F)		
Model No.	PH-3515F	PH-A14
XY range	254×152 mm	200×100 mm
PH-3515F main unit Order No.	172-868 ^{*1}	172-810 ^{*2}
Measuring unit	Digita	l scale
Quick-release mechanism	Only X-axis	-
Top surface size	450×146 mm	407×152.4 mm
Dovetail groove	Two (Pitch = 43 mm)	
Minimum swivel angle reading	30 '	-
Maximum measuring diameter (horizontally fixed) ^{*3}	ø340 mm	ø300 mm
Swivel adjustment range	±10 °	-
Maximum loading	45 kg	

Photo: Cutter (Outside diameter of 175 mm max.) is mounted on the tipped-saw support fixture (172-001).


*1 To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, D for CEE, DC for CCC, E for BS, K for KC, C and No suffix are required for PSE.

*2 To denote your AC power cable add the following suffixes to the order No.: -10A for UL/CSA, -20D for CEE, -20DC for CCC, -20E for BS, -20K for KC.

*3 When using the projection lens 10X (Standard accessory).

Quick-release mechanism allows rapid traverse



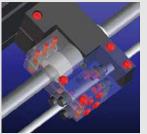




Twist roller system


Quick-release handle

A quick-release knob inside the X/Y handle allows you to switch stage feed between extremely coarse and fine traverse movement. Since the stage is completely free floating, it is very convenient when the distance to the next measuring position is large or when you need to return to the reference position swiftly. Since this mechanism has adopted the twist roller system, there is almost no shock in switching, and the feed is smooth.

Note: Except for PJ-PLUS Series and PH Series.

Dimensions of PH-A14

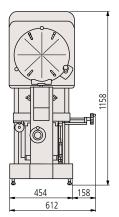

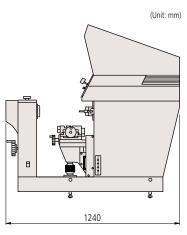

Stage


Accessories (Optional)

2-D Data Processing Unit QM-Data200

Mitutovo

The QM-Data200 is a geometric readout/analysis unit for optical instruments such as profile projectors. This unit features powerful 2-D coordinate measurement capabilities with easy-to-use key operation. Measurement results can be visualized on the LCD display and printed out if required.

Basic element measurement

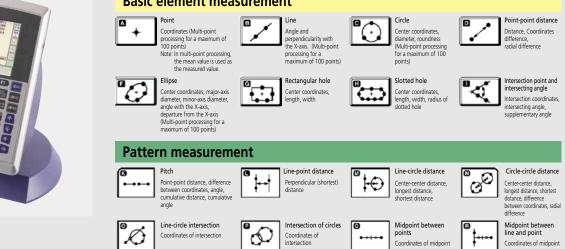

Specifications


Code	QM-Data200		
<u></u>	Stand-mount type	Arm-mount type	
Order No.	264-155 ^{*1}	264-156 ^{*1}	
Display languages (selectable)	Japanese/English/German/French/Italian/Spanish/Portuguese/Czech/Chinese/ Korean/Turkish/Swedish/Polish/Dutch/Hungarian		
Measured value unit	Length: mm Angle: degree/de	gree minute second (selectable)	
Resolution	0.1	μm	
Program functions	Part program creatic	n, execution, editing	
Statistical processing		ım value, mean value, standard deviation, asuring function basis (by command)	
Display system	COLOR TFT LCD (v	vith LED backlight)	
Edge Sensor Position Compensation	Supported	(Projector)	
Input/Output	XYZ : Maximum of three Linear Scales RS-232C : For connecting to external PC RS-232C : For connecting to counter of measuring instrument OPTOEYE : For inputting edge signal from OPTOEYE (OPTOEYE 200) FS : For connecting to optional Footswitch PRINTER : For connecting to optional printer USB-MEMORY : For connecting to USB memory		
Measurement result file output	RS-232C output (CSV format, MUX-10 format)		
Power	100 to 2	240 V AC	
Maximum power consumption	17 W (does not includ	e optional accessories)	
External dimensions (W×D×H)	Approximately 260×242×310 mm (including the stand)	Approximately 318×153×275 mm (when the arm is in the horizontal posture	
Mass	Approximately 2.9 kg	Approximately 2.8 kg	
Applicable models	PJ-PLUS Series PJ-H30 Series PV-5110 PH-3515F PH-A14	PJ-PLUS Series PJ-H30 Series PV-5110 ^{*2} PH-3515F* ² PH-A14* ²	
Standard accessories	AC adapter, power cab	le, Easy operation guide	

*1 To denote your AC power cable add the following suffixes to the order No.: A for UL/CSA, D for CEE, 00 for CCC (power cord for CCC and User's Manual set of Simplified Chinese are provided for separately), E for BS, K for KC, C and No suffix are required for PSE.


*2 The arm-mount type cannot be used concurrently with a counter stand.

Note: For details, refer to the QM-Data200 and Vision Unit brochure.

Operation screen (Counter)

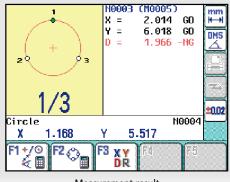

Measurement result

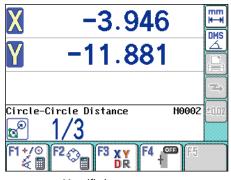

Magnified counter screen

Rotary tables

Used for rotating the workpiece on the stage without needing to handle it.



Order No.		172-198	176-305	176-306
Product Name		Rotary table with fine feed wheel	Rotary table with fine feed wheel A	Rotary table with fine feed wheel B
Rotary stage s	size	ø146 mm	ø240 mm	ø270 mm
Fine adjustme	ent	✓	\checkmark	\checkmark
Effective glass	s diameter	ø96 mm	ø182 mm	ø238 mm
Minimum angle reading		2 '	—	_
External dimensions (W×D×H)		240×172×19,7 mm	280×280×23,7 mm	342×342×23,2 mm
Mass		2,4 kg	5,5 kg	6,5 kg
PJ-PLUS Series		✓ *1	✓ *3	_
Applicable models PJ-H30	PJ-H30 Series	✓ *1	✓	\checkmark
	PV-5110	✓ ^{*2}	—	—

*1 Since the rotary stage section is small, if it is used for a large stage, some restrictions may be imposed on the measuring range.

*2 When using a 50X or a 100X projection lens, you need to remove the stage glass in order to prevent a collision between the stage glass for X/Y stage and the projection lens.

 $^{\ast}3$ It is possible to set for only the 2010 size.

Holder with clamp

Used for clamping down a thin workpiece, such as a board or a pressed product.



Order No.	176-107
Applicable models	PJ-PLUS Series PJ-H30 Series PV-5110
Maximum width to be clamped	0 to 35 mm
Mass	0,4 kg

V-block with clamp

Used for clamping a cylinder.



Order No.	172-234	172-378
Applicable models	PH-3515F	PJ-PLUS Series PJ-H30 Series PV-5110
Maximum workpiece diameter to be clamped	ø50 mm	ø25 mm
Central height from a mounting surface	38 to 48 mm	38 to 48 mm
Mass	1,24 kg	0,8 kg

Swivel center support

Used for holding a center-drilled workpiece. Since an inclination of ± 10 degrees can be set, it is suitable for helping measure the depth and flank angle of threads.



Order No.	172-197
Applicable models	PJ-PLUS Series PJ-H30 Series PV-5110
Maximum workpiece size to be clamped [*]	ø80 mm (65×140 mm)
Inclination	±10°
Mass	2,5 kg

* The maximum measurable dimension varies according to

that for an inclination of 10°.

the projection magnification. Dimension in parentheses is

Adapter

This enables a workpiece clamping option, such as the holder with clamp or the swivel center support, to be attached to the X/Y stage of the projector.

Order No.		176-304	176-310	176-317
Product Nam	e	Stage adapter	Stage adapter (B)	Stage adapter (C)
External dim	ensions (W×D×H)	50×340×15 mm	50×280×15 mm	73×278×17 mm
Mass		1,5 kg	1,2 kg	1,8 kg
	PJ-PLUS	_	✓	_
Applicable models	PJ-H30	✓	_	✓
	PV-5110	_	—	√

Accessories (Optional)

Rotary vise

Used for clamping a workpiece. It rotates the horizontal plane.



Order No.	172-144
Applicable models	PH-3515F
Rotation range	360 °
Size between mounting surface and top surface	76 mm
Minimum angle reading	5 °
Mass	2,8 kg

Center supports

Used for holding a center-drilled workpiece.



 Order No.
 172-142

 Applicable models
 PH-3515F

 Maximum workpiece diameter to be clamped
 120 mm (240 mm)*

 Mass
 3,3 kg

 * When center support risers (172-143) are
 Center support risers

These are used to raise the center supports to a more convenient working height, or to enable a larger diameter workpiece to be inspected.



Order No.	172-143
Applicable models	PH-3515F
Height	60 mm
Mass	2,2 kg

Vertical holder

Used for holding small thin parts.



Order No.	172-132
Applicable models	PH-3515F
Glass size	—
Mass	1,3 kg

Standard scale

Glass scale used for checking magnification accuracy



used.

Order No.	172-116	172-330	172-117
Range	50 mm	80 mm	2 in
Graduation	0,1 mm		0,01 in
Accuracy	(3+5L/1000) μm		(120+5L)×10 ⁻⁶ in
(20 °C)	L=Measured length (mm) L=Measured length		L=Measured length (in)

Working standard scale (Made to order)

Although the reference scale is used for checking the indication accuracy of the X/Y table, it also substitutes for a standard scale or a reading scale. A substitute for the standard scale is HL1, and that for the reading scale is HL2. Refer to page 15 for details of 14005 brochure.







Glass scale specially designed for inspecting the magnified image of a standard scale on the projection screen



Order No.	172-118	172-161	172-329	172-119	172-162
Range	200 mm	300 mm	600 mm	8 in	12 in
Graduation	0,5 mm			0,02 in	
Accuracy	(15+15L/1000) μm			(600+151	.)×10 ⁻⁶ in
(20 °C)	L=Measured length (mm)			L=Measured	l length (in)

Dimensions

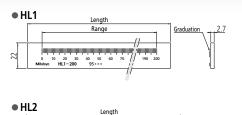

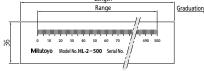





182-511-30 [*]	182-512-30 [*]	182-522-30 [*]	182-523-30 [*]	182-525-30 [*]
HL1-50	HL1-100	HL2-200	HL2-300	HL2-500
50	100	200	300	500
75	125	230	330	530
20 50			0	
Soda-lime glass				
1,5+2L/1000 L=Measured length (mm)				
	HL1-50	HL1-50 HL1-100 50 100 75 125 20 20	HL1-50 HL1-100 HL2-200 50 100 200 75 125 230 20 Soda-lime glass	HL1-50 HL1-100 HL2-200 HL2-300 50 100 200 300 75 125 230 330 20 20 5 5

* If the specified code No. ends with "-**30**," we will attach a calibration certificate. Note: The unit of the working standard scales is mm only.

Green filter

These filters are for adjusting image contrast and are inserted in the transmitted illumination section during use.



OPTOEYE 200 (Projected image position detecting device)





- An edge detecting device for improving the measuring efficiency and reliability of a profile projector by removing the need to position the crosshairs on an edge manually. This has the effect of eliminating the operator variability factor from data entry and shortening the measurement time.
- The detector uses an optical fiber that can be easily fixed on the screen with chart clips.
- The device is provided with an error detection function that works if the screen light intensity changes.
- This device can be retrofitted onto the QM-Data200 and does not need an AC adapter since power is supplied from the QM-Data200 through the connecting cable.
- When using the Optoeye system, there are two ways to connect: connection to the projector main unit via an RS-232C cable, or direct connection of the projector main unit's X- and Y-axis linear scales to QM-Data200.
- This system can be used in combination with the QM-Data200 but is only available for the PJ-H30A. (PJ-H30D does not need this system because it has a built-in Optoeye sensor.)

Order No.	172-160-3	12AAG981	172-160-2	172-286
Applicable models	PJ-PLUS	PJ-H30	PV-5110	PH-3515F
External dimensions (W×D) mm	50×110	195×260	50×167	58×120
Mass	0,3 kg	0,44 kg	0,3 kg	

Order No.	332-151
Model	OPT-200
Illumination	Contour/surface ^{*1}
Detecting directivity	Non-directional
Minimum detectable circle	ø2 mm
Minimum detectable line width	1 mm
Maximum response speed	1000 mm/s
Illumination range (Bright)	30 to 1500 IX
Bright-Dark field difference	20 ℓX or higher
Repeatability (contour illumination)	σ=1 μm ^{*2}

*1, *2 Mitutoyo's test conditions.

Configuration of standard accessories
Electronic unit
Detector: Optical fiber: 1950 mm
Connecting cable: For connecting electrical component main unit and QM-Data200
Fixture for QM-Data200 (12BAG139): For fixing the electrical component
main unit to OM-Data200

Note: Detector mounting plate is an optional accessory.

Built-in OPTOEYE (only PJ-H30D)



PJ-H30D

Detecting sensor: Built into center of the screen, non-directional Illumination⁺³, Minimum detectable circle: $\emptyset 2 \text{ mm}$ (projected image size), Minimum line width: 1mm (projected image size), Repeatability: $\sigma = 1 \mu m^{+4}$

*3 This may be undetectable depending on the illumination conditions. *4 Mitutoyo test conditions.


21

Accessories (Optional)

Overlay charts

Accessory

To quickly check an image projected on the screen, an appropriate chart is used. 13 types of overlay charts are available according to the application.

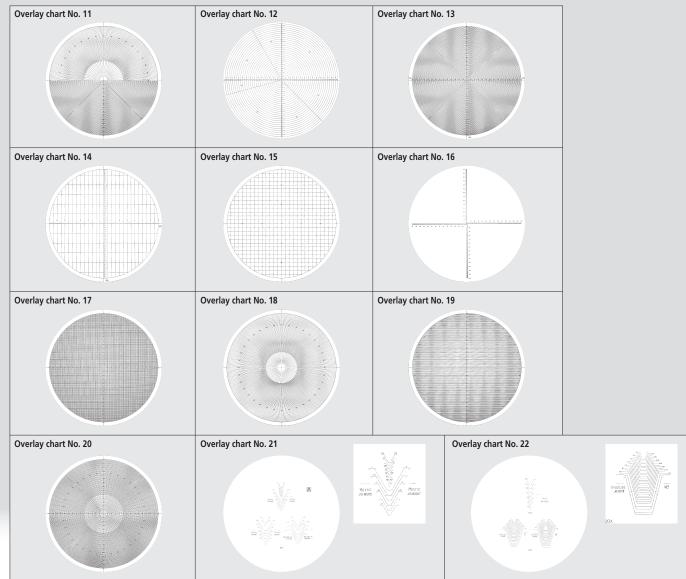


Product name	Order No.	Specification
Overlay charts Set of 12	12AAM027	Set of 12 charts (Overlay charts No.11 – No.22)
Overlay chart No.11	12AAM587	Upper side: radial lines (at intervals of 1°) Lower side: concentric circles (at intervals of 1 mm in radius)
Overlay chart No.12	12AAM588	Concentric circles (at intervals of 5 mm in radius) with crosshairs (1 mm graduation)
Overlay chart No.13	12AAM589	Concentric circles (at intervals of 1 mm in radius) with crosshairs
Overlay chart No.14	12AAM590	Horizontal: Parallel lines at intervals of 50 mm (50-times enlargement of 1 mm) Vertical: Parallel lines at intervals of 20 mm (20-times enlargement of 1 mm)
Overlay chart No.15	12AAM591	10 mm-interval grids
Overlay chart No.16	12AAM592	Crosshairs (0,5 mm graduation)

Product name	Order No.	Specification
Overlay chart No.17	12AAM593	1 mm-interval grids
Overlay chart No.18	12AAM594	1°-interval radial lines
Overlay chart No.19	12AAM595	Horizontal: 1 mm-interval parallel lines
Overlay chart No.20	12AAM596	Concentric circles (at intervals of 1 mm in radius) and radial lines (at intervals of 1°)
Overlay chart No.21	12AAM597	Metric screw for 20X lens: P = 0.2 to 2 mm Unified screw: 28 to 12 threads/in Whitworth screw: 20 to 10 threads/in
Overlay chart No.22	12AAM598	Metric screw for 100X lens: P = 0.08 to 0.25 mm Involute tooth profile for 20X lens (reference rack tooth profile) 20°m: 0.2 to 1 14.5°m: 0.2 to 1
Overlay chart (Staggered crosshairs)	12AAM599	Solid lines + Staggered crosshairs

Quick guide to Profile Projectors

Erect Image and Inverted Image

An image of an object projected onto a screen is erect if it is orientated the same way as the object on the stage. If the image is reversed top to bottom, left to right, and by movement with respect to the object on the stage (as shown in the figure below), it is referred to as an inverted image (also known as a reversed image, which is probably more accurate).

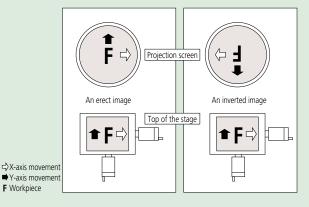

Magnification Accuracy

The magnification accuracy of a projector when using a certain lens is established by projecting an image of a reference object and comparing the size of the image of this object, as measured on the screen, with the expected size (calculated from the lens magnification, as marked) to produce a percentage magnification accuracy figure, as illustrated below. (Note that magnification accuracy is not the same as measuring accuracy.)

M : Magnification of the projection lens

Nominal magnification: Magnification displayed on the projection lens.

Type of Illumination


- Contour illumination: An illumination method to observe a workpiece by transmitted light and is used mainly for measuring the magnified contour image of a workpiece.
- Coaxial surface illumination: An illumination method whereby a workpiece is illuminated by light transmitted coaxially to the lens for the observation/ measurement of the surface. (A half-reflecting mirror or a projection lens with a built-in half-reflecting mirror is needed.)
- Oblique surface illumination: A method of illumination by obliquely illuminating the workpiece surface. This method provides an image of enhanced contrast, allowing it to be observed three-dimensionally and clearly. However, note that an error is apt to occur in dimensional measurement with this method of illumination.

(An oblique mirror is needed. Models in the **PJ-H30** Series are supplied with an oblique mirror.)

Basic knowledge


Telecentric Optical System

An optical system based on the principle that the principal ray is aligned parallel to the optical axis by placing a lens stop on the focal point on the image side. Its functional feature is that the image will not vary in size though the image blurs as the object is shifted along the optical axis. For measuring projectors and measuring microscopes, an identical effect is obtained by placing a lamp filament at the focal point of a condenser lens instead of a lens stop so that the object is illuminated with parallel beams. (See the figure below.)

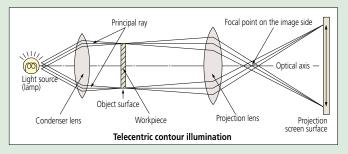


Working distance

Refers to the distance from the face of the projection lens to the surface of a workpiece in focus. It is represented by L in the diagram below.

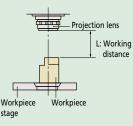

Parallax error

This means an error resulting from variations in the line of sight when reading a scale.

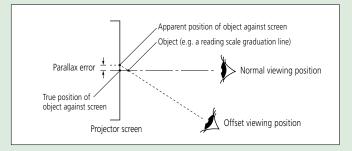

Field of view diameter

The maximum diameter of a workpiece that can be projected using a particular lens.

Field of view diameter (mm) =	Screen diameter of profile projector Magnification of projection lens used
a screen of ø500 mm	n lens is used for a projector with :: er is given by <u>500 mm</u> = 100 mm

Basic optical terminology

The ø100 mm range is projected over the entire projection screen.



Whatever your challenge are, Mitutoyo supports you from start to finish.

Mitutoyo is not only a manufacturer of top-quality measuring products but one that also offers qualified support for the lifetime of the equipment backed up by comprehensive services, ensuring your staff can make the very best use of the investment.

Apart from the basics of calibration and repair, Mitutoyo offers product and metrology training, as well as IT support for the sophisticated software used in modern measuring technology. We can also design, build, test, and deliver bespoke measuring solutions and even, if deemed cost-effective, take your critical measurement challenges in-house on a sub-contract basis



Find additional product literature and our complete catalog here.

www.mitutoyo.eu

Note: MITUTOYO is either registered trademarks or trademarks of Mitutoyo Corp. in Japan and/or other countries/regions. Other product, company and brand names mentioned herein are for identification purposes only and may be the trademarks of their respective holders. Product illustrations are without obligation. Product descriptions, in particular any and all technical specifications, are only binding when explicitly agreed upon.



Mitutoyo Europe GmbH

Borsigstraße 8-10 41469 Neuss Tel. +49 (0) 2137-102-0 Fax +49 (0) 2137-102-351

info@mitutoyo.eu www.mitutoyo.eu